① Publication number: 0 659 525 A2

12

EUROPEAN PATENT APPLICATION

(21) Application number: 94307098.7

(5) Int. CI.6: B25B 23/147, B23P 19/06

2 Date of filing: 28.09.94

30) Priority: 30.09.93 GB 9320181


(43) Date of publication of application : 28.06.95 Bulletin 95/26

(84) Designated Contracting States: CH DE ES FR GB IT LI NL SE

71 Applicant: Black & Decker Inc. Drummond Plaza Office Park 1423 Kirkwood Highway Newark Delaware 19711 (US) (7) Inventor: Shaw, David Martin Woodrising, Lartington Barnard Castle, County Durham (GB)

Representative: Stagg, Diana Christine et al Emhart Patents Department Emhart International Ltd. 177 Walsall Road Birmingham B42 1BP (GB)

- 64 Improvements in or relating to power tools.
- A drill/driver (eg. an electric drill) with a screwdriver attachment, and a method of controlling the drill/driver, are described. A control circuit (30) controls the speed of rotation of the motor (38, 39) through a time delay circuit (42) and a triac (41). The control circuit (30) uses the time delay information and information inputted from a rotational speed sensor (43) to monitor the current in the motor or a parameter related at least in part to current in the motor. When a change corresponding to an increase in the rate of change of current in the motor is detected, the control circuit (30) stops the motor to provide an automatic torque control feature for a screwdriving operation.

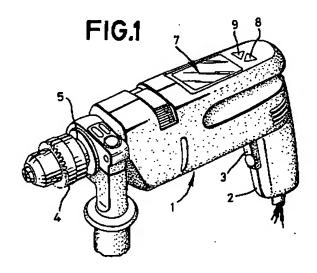

This invention relates to power tools, for example hand-held power tools and bench-mounted power tools. The invention has particular reference to hand-held and bench-mounted power screwdrivers and power drills with a screwdriving facility, and which are referred to as "drill/drivers" herein.

The efficient and economic use of power tools depends upon the correct selection of the conditions under which the tool is to be operated. For example, in a power drill, the speed of rotation of the drill bit depends upon the drill size and the material of the workpiece upon which the drill is to be used. In the case of screw-driving, the rotational speed of the screwdriver is determined in accordance with the screw size. It is also important to be able to stop the tool when the screw has been screwed home fully to avoid overloading the tool driving motor or damage the workpiece.

It has been proposed to employ electronic means to determine, in accordance with information fed to the means by a user, the rotational speed of the motor driving the tool holder of the power tool, such means also maintaining the set speed at a constant value and monitoring the conditions under which the power tool is operating. In particular, the means may monitor the torque exerted by the tool and operate to de-energise the power tool motor in the event that the torque exceeds a safe value, but the prior proposals have not been totally effective.

Accordingly, it is an object of the present invention to provide a power tool with a more effective torque sensing and control arrangement.

One aspect of the present invention is based upon the results of observations of the current which passes through the motor of the power tool during operation, and specifically of the current passing through the motor of a drill/driver as herein defined as it operates to screw a screw into a workpiece. In this respect reference is made to Figure 4 of the accompanying drawings, which is a graph showing changes in motor current (vertical axis) against time (longitudinal axis) that take place during a screw driving operation. The contour of the graph is substantially the same for all permitted screw sizes but the actual current values will depend on the screw size. During period T1, there is a gradual increase in motor current as the screw penetrates the surface of and starts to enter a workpiece, there being a gradual increase in the resistance to rotation offered to the screw. There then follows a time period T2 during which the current flow is substantially constant as the screw thread enters and is driven further into the workpiece. At the end of time period T2, the screw is almost fully home and the screw head engages the surface of the workpiece. As the pressure between the screw head and the surface increases, there is a rapid increase in motor current over the time period T3 at the end of which the screw is fully home and it is then essential to de-energise the tool motor.

One aspect of the present invention monitors the current in the motor of the tool, and takes advantage of the rapid increase in current when the head of the screw comes into contact with the workpiece.

According to this aspect of the present invention, therefore, a drill/driver as herein defined comprises a rotatable shaft adapted to mount a screwdriver bit,

a motor for rotatably driving the shaft,

5

10

15

20

30

35

40

45

50

55

means for monitoring the current in the motor or for monitoring a parameter related at least in part to current in the motor, and

means responsive to a detected change corresponding to an increase in the rate of change of current in the motor, and operative to stop the motor.

For example, the drill/driver may comprise a speed controller for controlling the speed of rotation of the motor. The means for monitoring the current or other parameter may then monitor the power consumption of the motor.

In one embodiment, the motor may be an A.C. motor, the speed controller may include voltage controlled rectifier means (also known as gated rectifier means), such as a triac bidirectional rectifier, for controlling the "power-on" portion or portions of each A.C. cycle in order to achieve a desired speed. The means for monitoring the current or other parameter may then comprise means for monitoring the duration of each "power-on" portion. This can be done by monitoring the conduction time of the voltage controlled rectifier means, or by monitoring the relative phase (time delay) at which the voltage controlled rectifier means is triggered. The duration of the "power-on" portion will be related to the load under which the motor is operating, and hence to the current consumption of the motor.

In some circumstances it may be desirable to continue the screwing operation after the rate of current change has increased, and in one embodiment therefore a time delay is built into the control mechanism to delay, e.g. for a second or so, the motor cut-off. In another embodiment a manual override may be provided, so that the user may select either automatic cut-off control or manual control.

The means for monitoring the current or other parameter, and the means for stopping the motor may be implemented in dedicated hardware circuits, and/or by processor means (e.g. a microprocessor or a microcontroller) programmed and configured by software.

in a closely related manner, this aspect of the invention also provides a method of controlling a drill/driver

as defined herein, the drill/driver including a rotatable shaft adapted to mount a screwdriving bit and a motor for rotatably driving the shaft, the method comprising a first step of monitoring the current in the motor or monitoring a parameter related at least in part to the current in the motor, and a second step of stopping the motor in response to detection of a change corresponding to an increase in the rate of change of current in the motor.

According to a further aspect of the present invention there is provided a method of controlling a drill/driver, the drill/driver including a rotatable shaft arranged to mount a screwdriver bit and a motor for rotatably driving the shaft, the motor being driven only during predetermined conduction periods, the method arranged to provide, within a given time period, a value which is a function of the conduction period necessary to maintain a given motor speed, and wherein the motor is stopped if this value has exceeded a predetermined amount before the end of the given time period.

By way of example only, two emobidments of hand-held power drill/driver according to the present Invention will now be described in greater detail with reference to the accompanying drawings of which:

Fig. 1 is a perspective view of part of the drill/driver,

Fig. 2 is a plan view of a display panel and keyboard of the drill/driver,

Fig. 3 is a block schematic of the control means of the drill/driver,

Figs. 4 and 5a/b are explanatory diagrams,

5

10

15

20

25

30

35

45

50

55

Figs. 8a/b/c are a flow diagram illustrating control of the drill/driver,

Fig. 7 illustrates schematically a shift register according to the second embodiment of the present invention;

Fig. 8 shows a flow chart of the second embodiment of the present invention;

Figure 9 Illustrates schematically typical data held within the register of Figure 7 when there is no load on the drill/driver;

Figure 10 illustrates schematically typical data held within the register of Figure 7 when the drill/driver is screwing a screw into a workpiece; and,

Figure 11 illustrates schematically typical data held within the register of Figure 7 when the end of the screwing operation has been reached.

The drill/driver shown in Fig. 1 is of generally conventional outward appearance having a body 1 and a handle 2 with a trigger 3 that controls an ON/OFF switch housed in the handle 2. The trigger 3 also incorporates a reversing switch (not shown), although if desired the selection of reverse may be prevented other than during a screwdriving operation. A chuck 4 is detachably mounted on the end of a drive shaft 5 that extends from the body 1 as shown.

Located on the upper surface of the body 1 in a position easily accessible to, and easily visible to, a user is a keyboard 6 and a display, for example a liquid crystal display (LCD) screen which, together, make up a display panel 7. The display panel 7 is part of a unit that is accommodated within the body 1 and that is held between the clam shell halves that make up the body 1 and handie 2.

The keyboard 6 has two keys covered by a membrane that covers the actual keys and has upstanding portions 8, 9 in the form of arrow heads that identify the individual keys. To enable a user readily to identify which key to use, the arrow heads 8, 9 point upwardly and downwardly respectively and bear the legends "+" and "-". Beneath the upstanding portions are located the movable elements of the key switches. Such elements may comprise blocks of conductive rubber that are attached to or integral with the membrane and which cooperate with fixed contacts on a surface below the membrane to form the key switches. Downward pressure on an upstanding portion of the membrane brings the block of conductive rubber into electrical contact with the respective fixed contact or conductor pattern on the printed circuit board. As soon as the pressure is removed, the block moves away from the fixed contact.

The LCD 10 forms part of the display panel 7 which has, adjacent the display 10, columns 12, 13, 14, 15 each with a series of numbers that are drill sizes expressed in millimetres. The numbers are arranged in horizontal rows as shown. At the head of each column are symbols 18, 17, 18, 19 that indicate, respectively, metal workpieces, brick workpieces, wooden workpieces and aluminium workpieces. Below the columns are two horizontal sections 20 and 21 that contain symbolic representations of screws of different sizes and the letters "ATC" (Automatic Torque Control). At the upper right hand edge of the display 10 is symbol 22 representing a polishing or wirebrushing brush. On the right hand side of the display 10 towards the lower end thereof is a set of symbols 23, 24, 25, 26 that represent respectively a hole cutter, metal workpieces, aluminium workpieces, and wooden workpieces. Engraved on the surface of the display panel in the vicinity of the symbols 23... 26 is a two-part arrow head 27 whose point terminates just below a horizontal line 28.

At the lower end of the display panel, as viewed in Fig. 2, Is the marking Ømm. (diameter).

The LCD 10 consists of a series of twelve bar segments arranged one above the other. The segments become visible when the switches are operated by a user, depression of the "+" switch causing the number of visible segments to increase from the bottom of the display, whilst depression of the "-" switch has the reverse

effect. Depressing both switches together causes the motor to run at maximum speed. By way of example, three visible segments are shown in Fig. 2 at 29. As can be seen from Fig. 2 the segments are so positioned in the display that, when visible, they are aligned with the different horizontal rows of numbers of the columns 12 ... 15. The display panel 7 enables a user to select the optimum speed (with automatic torque control for screwdriving) for small or large screws (as denoted by the sections 20, 21) or for drilling in metal, brick, wood or aluminium (as denoted by legends 12, 13, 14, 15), or for polishing/wirebrushing (as denoted by legend 23 in association with the range legends 24-28).

Beneath the lower end as viewed in Fig. 2, of the LCD display is the marking 200 RPM (the minimum motor speed) on the same horizontal row as the marking Ømm. Above the upper end of the display is the marking 2600 RPM (the maximum motor speed).

10

15

30

35

40

45

Fig. 3 is a block schematic diagram of the tool motor control circuit and comprises a microprocessor 30, for example type 50927 made by the Mitsubishi Company of Japan. The keys of the keyboard beneath the arrow heads 8, 9 shown in Fig. 2 are indicated at 31 and 32 respectively and they input directly to microprocessor 30. Block 33 represents a reset circuit whose function is described below. Block 34 is the LCD 10 whose segments are energised directly from microprocessor 30 as shown. The control circuit is energised from a mains supply at terminals 35, 36 via a power supply unit shown as block 37 and which drops the mains voltage to levels required by the control circuit and at the same time provides the conventional voltage stabilisation. Connected across the terminals 35, 36 is the tool driving motor armature 38 and its series connected field windings 39. The trigger-operated motor control switch is shown at 40. The supply of power to the motor is regulated by a triac 41 that is series connected with the motor and whose firing angle is controlled by the microprocessor 30 via a control circuit shown in Fig. 3 as block 42. In this exemplary embodiment, the control circuit 42 comprises a programmable timer which is supplied with a 4-bit time delay input from the micro-processor 30. The time delay corresponds to the phase angle delay at which the triac 41 is to be triggered into conduction. Regulation of the rotational speed of the motor is effected by the microprocessor in conjunction with a motor shaft speed measuring circuit represented by block 43. Circuit 43 receives an input from a speed sensing device (not shown) associated with the motor shaft and which may be an optical sensor comprising a slotted disc mounted on the shaft and a light source arranged to direct light through the slotted disc onto a light responsive device. Alternatively, the sensor may be a form of magnetic sensor, for example a Hall effect type sensor, or

The control circuit also provides soft start on all operations, anti-kick back protection in all modes, rotation in the reverse direction being permitted only in the screwdriving mode and following operation of the anti-kick back protection.

Also included in the control circuit is thermal protection of the motor by means of a thermistor or thermostat shown as block 44 that provides a signal indicating motor temperature.

When the drill/driver is operating in the drilling mode, the control circuit permits the user to select the optimum speed for the drill size and work piece material and maintains that speed despite permitted variations in the load on the motor.

When the drill/driver is operating in the screwdriving mode, the control circuit allows selection of small or large screws and automatic torque control.

In the hole cutting mode, optimum speed selection and control thereof is provided.

In both polishing and wirebrushing modes the control circuit maintains the motor speed at a constant value despite permitted variations in the load on the motor.

Reference 45 represents information contacts on the reversing switch.

As has been explained above, when a screw driving operation is being carried out, it is important to be able to stop the tool motor when the screw has been driven fully home. The drill/driver incorporates torque control to achieve that facility.

Figures 5(a) and 5(b) are waveforms showing the triac conduction patterns when (a) the driver is driving the shank of the screw into the workpiece and (b) the head of the screw comes into contact with the workpiece. In these waveforms, the lines F1 ... F6 represent a set of firing angles, the firing angles being a measure of the time the triac is on (i.e. the triac conduction time) in order to turn the chuck of the driver at a certain predetermined speed, e.g. 200 r.p.m. As load is applied to the chuck the conduction time is increased, in order to maintain the required speed. Thus, while the shank is being driven into the workpiece, Figure 5(a), the conduction time (or firing angle) represented by the hatched portion is small. When the screw head reaches the workpiece, however, a substantial increase in conduction time would be required to maintain the speed, as shown by the hatched portion in Figure 5(b). The microprocessor 30 is programmed to recognise the sudden change from the Figure 5(a) situation to that of Figure 5(b) and stop the motor when this occurs.

Thus, as mentioned, the lines F1 F6 on Figures 5(a) and (b) represent a set of firing angles of the triac, and by monitoring the rate of increase in the firing angle it is possible to detect accurately the instant at which

10

15

20

25

30

50

It is desirable to de-energise the tool motor at the end of a screwdriving operation. Thus, each of the firing angles F1 ... F8 is defined by a value, in this example a 4-bit code, for example angle F1 is defined by the code 0000, F2 by the code 0001, F3 by the code 0011 and so on. The definition of the firing angle is effected by the programming of the microprocessor.

The microprocessor is also programmed to monitor the rate of change of firing angle and, when a change from say the angle defined by the code 0110 to that defined by the code 1000 occurs within a predetermined time period then the tool motor is de-energised. This illustrates how, in the current example the motor is stopped when there is a detected change which corresponds to an increase in the rate of changed of current in the motor. That is, the increase in firing angle within a predetermined time is detected and this firing angle is one such parameter which is related at least in part to the current in the motor. The firing angle codes between which the comparison is made are selected to indicate those at the beginning and the end of the time period T3 shown in Fig. 4.

To bring the drill/driver into use, it is first necessary to connect it to a source of mains power. That initiates a resetting of the control circuit by a signal from the reset circuit 33. Resetting involves the clearing of all memories in the control circuit including that of the LCD 10 and the setting up of all input and output ports and interrupts.

Figs. 6a-c illustrate in flow diagram form a control program for the microprocessor 30. Initially, upon reset as described above, the program is started at step 50 which sets various default values for the drill, for example, the default drill speed for the display panel 7.

After the initial step 50 the program proceeds to step 52 which tests whether the switch 40 coupled to the trigger 3 is being operated. If the switch is not being operated the program loops through step 54 which implements any input from the display panel 7, the program returning to the test step 52. The program repeats this loop until the user presses the trigger 3 thereby operating the switch 40.

Once the switch 40 is operated, the program proceeds to further initialisation steps 56 and 58 which set up control variables to control the operation characteristics of the drill/driver. One feature of the drill/driver is soft-start of the drill motor which gradually accelerates the motor rotation from rest until the desired speed is attained. To achieve a slow turn-on, program step 58 loads the control circuit 42 with a maximum timer value (which corresponds to a maximum delay before the triac 41 is fired, and hence a minimum conduction time).

Speed control is Implemented by program steps 60-70 and the soft-start feature is Implemented by a sub-loop within the speed control steps as indicated by the loop return 72. Step 60 tests whether the AC power supply is crossing through zero and, If not, the step is merely repeated until a zero-cross is detected. Thereafter, step 62 starts the control circuit (timer) 42 to fire the triac after the predetermined time delay. Step 64 refreshes the soft-start variables if the soft-start feature is still in operation. In particular step 64 reduces the time delay value for the control circuit (timer) 42 in order to increase the conduction time of the triac 41, and hence increase the motor speed. Step 68 tests whether the motor has yet attained has or almost attained the desired speed and, if not, the program loops back along the loop return 72 to step 60. Once the motor achieves approximately the desired speed, the program proceeds to step 68 which terminates the soft-start operation. Steps 68 and 70 also perform a speed monitoring and speed stabilisation process. In particular a proportional internal differential (P.I.D) parameter is calculated which indicates the difference between the actual motor speed and the desired speed. Step 70 refreshes the value for the control circuit (timer) 42 and adjusts the value as necessary depending on the P.I.D. parameter. If the actual speed is less than the desired speed, the timer value is decreased thereby to increase the conduction time of the triac 41. If the actual speed is greater than the desired speed, the timer value is Increased thereby to decrease the conduction time of the triac 41.

If the screwdriver option has been selected, the program passes through step 74 to the automatic torque control feature implemented by program steps 76-90. Steps 76 and 78 perform calculations based on the time delay outputted to the control circuit (timer) 42 to determine a working (current-related) slope and an actual (current-related) slope. The working slope represents the slope when the shank of the screw is being driven into the workpiece (represented by the portion T2 of Fig. 4). Step 80 tests whether the actual slope exceeds the working slope. The program then modifies a variable called "slope counter" depending on the outcome of the test. The variable indicates the number of recent program occurrences for which the actual slope has exceeded the working slope. Each time that the test step 80 Indicates that the actual slope is not greater than the working slope, the program proceeds to step 82 which decrements the slope counter variable. Steps 84 and 88 then test whether the variable has dropped below zero and, if so, the variable is made equal to zero. Each time that the test step 80 indicates that the actual slope is greater than the working slope, the program proceeds to step 88 which increments the slope counter variable. Step 90 then tests whether the variable has exceeded a predetermined value; in this exemplary embodiment the predetermined value is 5. If the predetermined value has been exceeded, this is the condition for the drill to be stopped automatically, and the program branches to a program label "waitoff" described below. If the predetermined value has not been exceeded,

normal program execution continues.

10

15

20

30

35

40

45

50

55

This technique with the slope counter variable therefore implements a short delay before turning off the motor after the actual slope is detected to be greater than the working slope. The motor is not turned off until six consecutive or recent occurrences of such a condition have been detected. The program also avoids stopping the motor in the event of a low number (less than six) of spurious occurrences of an increased slope, since the program steps 82-86 will decrement the value of the slope counter variable on the next occasion that the actual slope is not greater than the working slope.

The program label "waitoff" leads the program into steps 92-96 which automatically stop the motor. Program step 92 halts the control circuit (timer) 42 thereby to inhibit further conduction of the triac 41, which in turn turns off the power supply to the motor. Program step 94 tests whether the user has yet released the trigger 3 to deactivate switch 40 and, if not, program step 94 is repeated until the user releases the trigger 3. Thereafter, program step 96 returns the program execution to program label "loop-off" which leads back to program step 52, to enable the drill to be re-used.

If the program does not branch to "waitoff", execution continues to steps 98-108 which provide an overheating prevention feature. A variable called "temperature counter" is used to record the number of consecutive occasions that an overtemperature condition occurs. Program step 100 decrements the temperature counter to zero when the drill is not overtemperature, and program execution then jumps to step 110 discussed below. Program step 102 increments the counter when the drill is overtemperature. Program step 104 then tests whether the temperature counter variable has exceeded a predetermined "limit" and, if so, the program branches to the "waitoff" routine if the drill is not in its maximum speed setting. If the drill is in its maximum speed setting the program continues to step 110.

Program step 110 tests whether the switch 40 is off, i.e. whether the user has released the trigger 3. If not, then the program loops back to a program label "loop-on" which returns to program step 60. In this manner, the program is repeated to provide continuous speed control and, in the screwdriver mode, automatic torque control. If the switch 40 is determined to be off, then program step 112 halts the control circuit (timer) 42 thereby to stop the drill motor in the same manner as program step 92 discussed above. The program then continues to program step 96 which jumps to the program label "loop-off".

When the drill is not operating in the screwdriver mode, the automatic torque control feature provided by program steps 76-90 is bypassed. A program branch is performed by step 74 through step 114. Step 114 provides anti-kickback protection.

A further safety feature is also provided by a program step 116 interposed between steps 62 and 64 in the speed control portion of the program. Step 116 tests whether the "reverse" switch of the drill has been operated while the drill is in use (i.e. motor turning). If so, program execution branches to step 118 which halts the control circuit (timer) 42 thereby to stop the drill motor. The program then jumps to the program label "wait-off" described above.

The described embodiment is a drill driver which has an LCD. The invention is of course applicable to any power driver or power drill having a screwdriving facility, against which may be mentioned, for example, power drill/drivers wherein the pre-setting of the tool is by means of a rotating switch controlling a potentiometer rather than by buttons on an LCD display panel.

A second embodiment of the present invention will now be described with reference to Figures 7 and 8.

Figure 7 illustrates schematically a sixteen-stage serial memory shift register 114. The register 114 is part of the microprocessor 30 and operates under the control thereof. In addition to supplying the programmable timer within the control circuit 42 with a time delay input, the microprocessor 30 also supplies this time delay to the register 114 in the following manner.

Each half-cycle during which the triac 41 may be fired, as illustrated in Figures 5a and 5b, Is of 10 ms duration. This 10 ms half-cycle corresponds to 500 counts made by the microprocessor 30. So if, for example, there was a delay of 2ms before the triac 41 was fired during any given half-cycle, this would correspond to a count of 100. It will be noted that it is the delay before firing rather than the duration of the firing itself of the triac 41 which is being measured.

Referring once again to Figure 7, it will be seen that into each of the sixteen stages of the register 114 is inputted from the microprocessor 30 the count which corresponds to the delay before firing the triac 41 for that half-cycle. Thus the most recent (i.e. the current count) count occupies stage number 1 and the oldest count occupies stage number 16. It will be apparent that the time span over which the shift register 114 occupies memory is 160 ms (16 stage each of 10ms duration) and that the shift register is of the last-in-first-out (LIFO) type.

The counts within each of the stages of register 114 is, as in the previous example, the time delay before firing of the triac 41 necessary to maintain the shaft of the drill/driver rotating at a constant speed, here 200 r.p.m.

Once the drill/driver has been energised for a sufficient length of time for all stages of the register 114 to hold a respective count, then the microprocessor performs the following calculations necessary to determine whether to continue the energisation of the drill/driver or to stop it.

For each count update of the shift register 114, the microprocessor 30 divides the sixteen stages of the register 114 into two halves. One half comprises the eight oldest counts, 8_{OLD} , and the other half comprises the eight newest counts, 8_{NEW} .

The microprocessor 30 then calculates the average of all the 8_{OLD} counts, $\overline{8_{OLD}}$, and also the average of all the 8_{NEW} counts, $\overline{8_{NEW}}$. This results in two derived values $\overline{8_{OLD}}$ and $\overline{8_{NEW}}$.

Next the following calculation is performed:

10

15

20

25

30

45

50

55

The value RESULT is a single number and is used for comparison with a further derived value, as will be described below. It will, however, be apparent that because each of the counts in the register is 114 is actually a measure of the delay before firing the triac 41 then, as the shank of a screw is driven further into a workplece and thus the resistance offered by the screw to the drill/driver increases, then the delay before firing must be concomitantly reduced in order to maintain a steady 200 rpm, as described with reference to the previous embodiment. Hence, as the screw takes further and further into the workplece, then the values $\frac{8_{\text{NEW}}}{8_{\text{NEW}}}$ and $\frac{8_{\text{OLD}}}{8_{\text{NEW}}}$ over a given period of time, the RESULT will not itself change unless the rate of change between $\frac{8_{\text{OLD}}}{8_{\text{NEW}}}$ and $\frac{8_{\text{NEW}}}{8_{\text{NEW}}}$ over a given period of time, the RESULT will not itself change unless the rate of change between $\frac{8_{\text{OLD}}}{8_{\text{NEW}}}$ and $\frac{8_{\text{NEW}}}{8_{\text{NEW}}}$ changes. This achieves a measure of the gradient as shown previously with reference to Figure 4.

As has been stated above, it is necessary for the derived value RESULT to be compared with another derived value in order for a judgement to be made as to whether or not to de-energise the drill/driver. This derived value, SENSITIVITY is calculated as follows:-

SENSITIVITY =
$$K - \frac{8_{NEW}}{4}$$

where K is a number and is a constant for a particular drill/driver and $\overline{8_{NEW}}$ is the average value of the 8_{NEW} counts shown in Figure 7.

The microprocessor 30 de-energises the drill only if the following condition holds:

This decision making process is illustrated by the flow chart shown in Figure 8.

If the condition that RESULT > SENSITIVITY does not hold, then the whole process described above is repeated, but with the counts in the register 114 updated by one stage, i.e. by another half-cycle. This means that all previous values 1-15 move one stage further along the register 114, with value 16 being discarded and a new value at stage 1 being input by the microprocessor 30.

Referring now once again to the derived value SENSITIVITY, it will be appreciated that in some circumstances it may be desirable to give different drill/drivers different levels of sensitivity, that is to place constraints on the rate of increase of current, or parameter related at least in part thereto, which can be tolerated before de-energising takes place.

For example, as has been described hereinbefore, the actual current values through the motor will depend upon the screw size. It will also depend on the hardness of the workpiece into which the screw is being driven. Thus, for a small screw being driven into a soft wood, a much smaller current and shallower gradient of curve (see Figure 4) will be seen than for a large screw being driven into a hard wood, however, as has been described above, if the drill/driver, on driving the shank of the large screw into hard wood, detects changes in resistance offered by the screw (due to, say, inhomogeneties in the wood) sufficient to hold good the requirement that RESULT > SENSITIVITY, then the drill/driver will be de-energised.

This change in resistance offered by the large screw may, in absolute terms, be the same as would be offered by the head of a small screw coming into contact with the surface of soft wood.

So, if the drill/driver were actually being used to drive a small screw into soft wood, a satisfactory result would have been achieved. However, if the drill/driver had been driving a large screw into hard wood, an undesired de-energising would have resulted.

Thus, by offering the capability of changing the value of K for different drill/drivers, the above problem could be alleviated. For example, K could be set such that the problem outlined above could be altered so that only large screws are to be used with the particular drill/driver in question. This is because the resistance offered by the head of the small screw engaging a worksurface would not be sufficient to cause RESULT > SENSITIVITY to hold due to the change in SENSITIVITY caused by altering the value of K.

Examples of values used in the above calculations are shown below and with reference to Figures 9 - 11. It will be noted that in each of these Figures the data held within the shift register 114 is actually held both in hexadecimal and in decimal. The value of K has been chosen here to be 400.

Figure 9 shows both the hexadecimal count and the corresponding decimal count for each of the sixteen

stages in the shift register 114 for a drill/driver being run under a no-load condition, i.e. the drill/driver is energised but being run in free space without any resistive load engaging the chuck 4. The decimal values are then split into the θ_{OLD} and θ_{NEW} values as described hereinbefore.

The calculations necessary to decide whether or not to de-energise the drill/driver are then undertaken.

As can be seen by referring to the decimal column of Figure 9,

$$8_{OLD} = 372$$
 and $8_{NEW} = 371$
So $8_{OLD} - 8_{NEW} = 372 - 371 = 1$
 \therefore RESULT = 1

And the value with which RESULT is to be compared, SENSITIVITY, is derived as follows:

SENSITIVITY
$$= \frac{(K - \aleph_{NEW})}{4}$$

$$= \frac{(400 - 371)}{4}$$

$$= 7$$

5

10

15

20

25

30

40

45

55

Thus RESULT < SENSITIVITY and so the drill/driver is not de-energised and so all the values in the stages of the register 114 are scrolled on by one place losing the oldest value and providing a new current, or as in Figures 9 - 11, ACTUAL value.

Figure 10 shows the case of a drill/driver performing a screwing operation along the region T2 in Figure

Here it can be seen that
$$\overline{8_{OLD}}$$
 = 348 and $\overline{8_{NEW}}$ = 338
Thus $\overline{8_{OLD}}$ - $\overline{8_{NEW}}$ = RESULT = 10
and SENSITIVITY = $\frac{(400 - \overline{8_{NEW}})}{4}$ = $\frac{(400 - \overline{338})}{4}$ = 15

Thus RESULT < SENSITIVITY and so, again, the driver is not de-energised.

Figure 11 shows the case during the transition from region T2 to region T3 of Figure 4.

Here it can be seen that
$$\overline{8_{OLD}}$$
 = 357 and $\overline{8_{NEW}}$ = 317 thus RESULT = $\overline{8_{OLD}}$ - $\overline{8_{NEW}}$ = 357 - 317 = 40 and SENSITIVITY = $\overline{\frac{(400 - 317)}{4}}$ = 20


Thus RESULT > SENSITIVITY and so the drill/driver is de-energised.


Claims


- 35 1. A drill/driver (1) comprising: a rotatable shaft (5) arranged to mount a screwdriver bit; a motor (38,39) for rotatably driving the shaft (5); monitor means (30) for monitoring the current in the motor (38,39) or for monitoring a parameter related at least in part to current in the motor (38,39), characterised by further comprising means (30) responsive to a detected change corresponding to an increase in the rate of change of current in the motor (38,39), and operative to stop the motor (38,39).
 - 2. A drill/driver according to claim 1, further comprising a speed controller (41) for controlling the speed of rotation of the motor (38,39).
 - A drill/driver according to claim 2, wherein the means (30) for monitoring the current or other parameter comprises means for monitoring the power consumption of the motor (38,39).
 - 4. A drill/driver according to claim 3, wherein the motor is an A.C. motor, and the speed controller (41) comprises voltage controlled rectifier means for controlling the power-on portion or portions of each A.C. cycle in order to achieve a desired speed.
- 50 5. A drill/driver according to claim 4, wherein the means (30) for monitoring the current or other parameter comprises means for monitoring the duration of each power-on portion.
 - A drill/driver according to claim 5, wherein the means (30) for monitoring the duration comprises means for monitoring the conduction time of the voltage controlled rectifier means.
 - A drill/driver according to claim 5, wherein the means (30) for monitoring the duration comprises means for monitoring the relative phase at which the voltage controlled rectifier means is triggered for conduction.


EP 0 659 525 A2


- 8. A drill/driver according to any preceding claim, further comprising control means (42) for implementing a delay before the motor is stopped once a change corresponding to an increase in the rate of change of current has been detected.
- A drill/driver according to any preceding claim, further comprising manual override means for selecting either automatic cut-off control or manual control of the motor.
 - 10. A method of controlling a drill/driver, the drill/driver including a rotatable shaft arranged to mount a screw-driving bit and a motor for rotatably driving the shaft, the method comprising a first step of monitoring the current in the motor or monitoring a parameter related at least in part to the current in the motor, and a second step of stopping the motor in response to detection of a change corresponding to an increase in the rate of change of current in the motor.
 - 11. A method of controlling a drill/driver, the drill/driver including a rotatable shaft arranged to mount a screw-driver and bit and a motor for rotatably driving the shaft, the motor being driven only during predetermined conduction periods, the method arranged to provide, within a given time period, a value which is a function of the conduction period necessary to maintain a given motor speed, and wherein the motor is stopped if this value has exceeded a predetermined amount before the end of the given time period.
 - 12. A method according to claim 11 wherein the given motor speed is a steady motor speed.

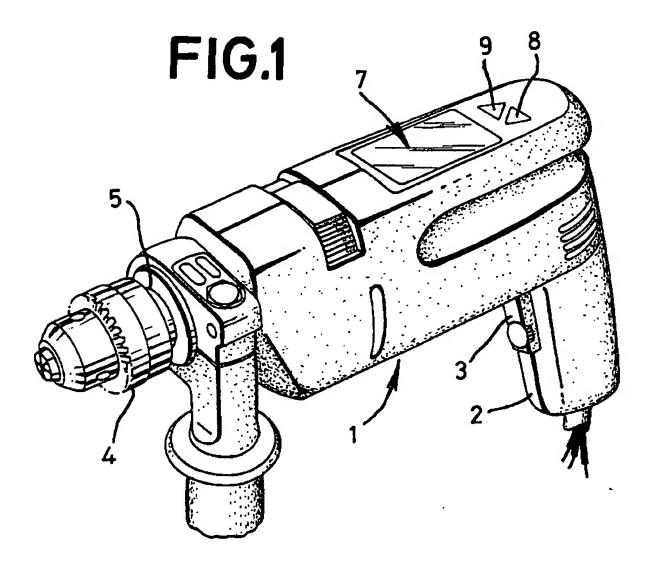


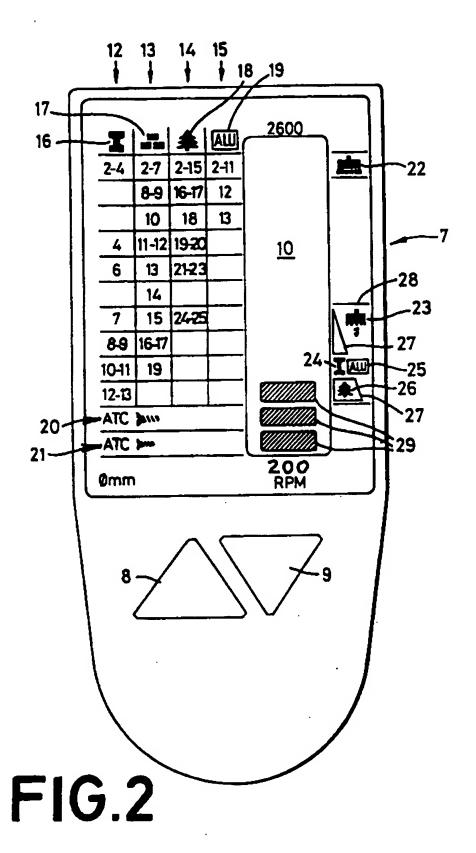

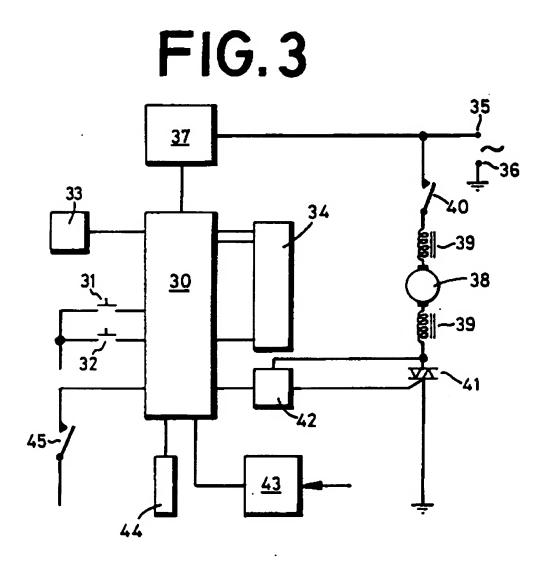

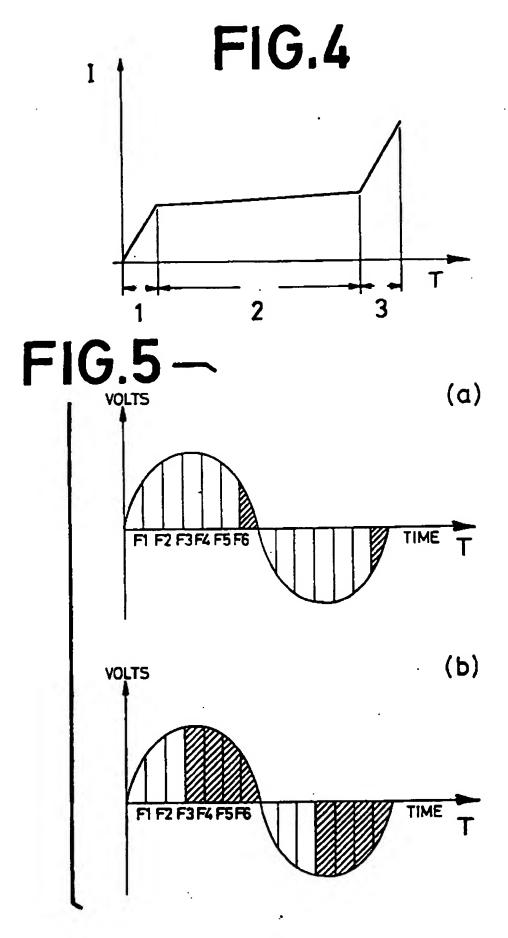

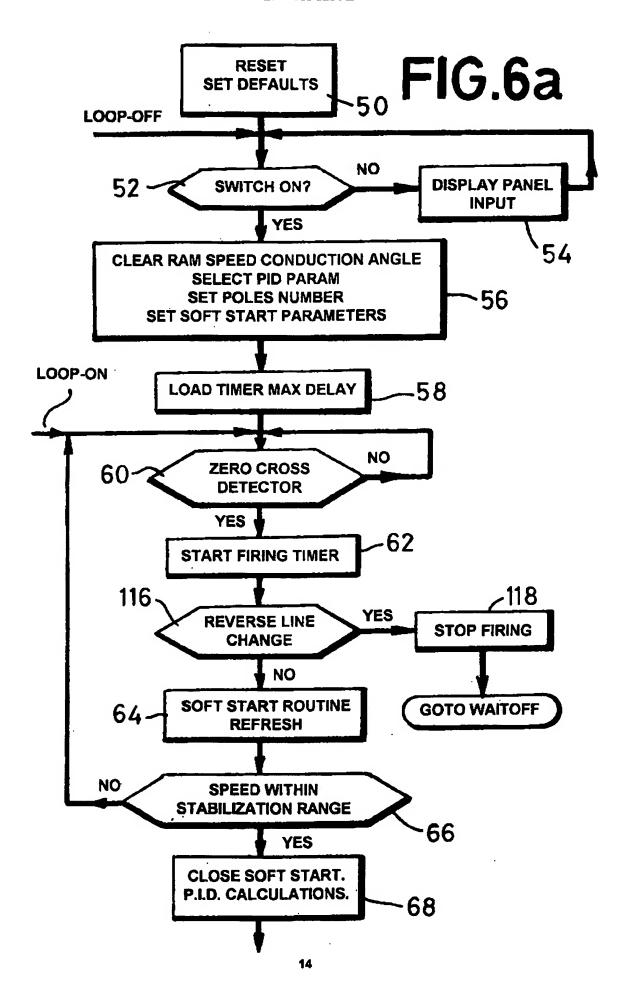

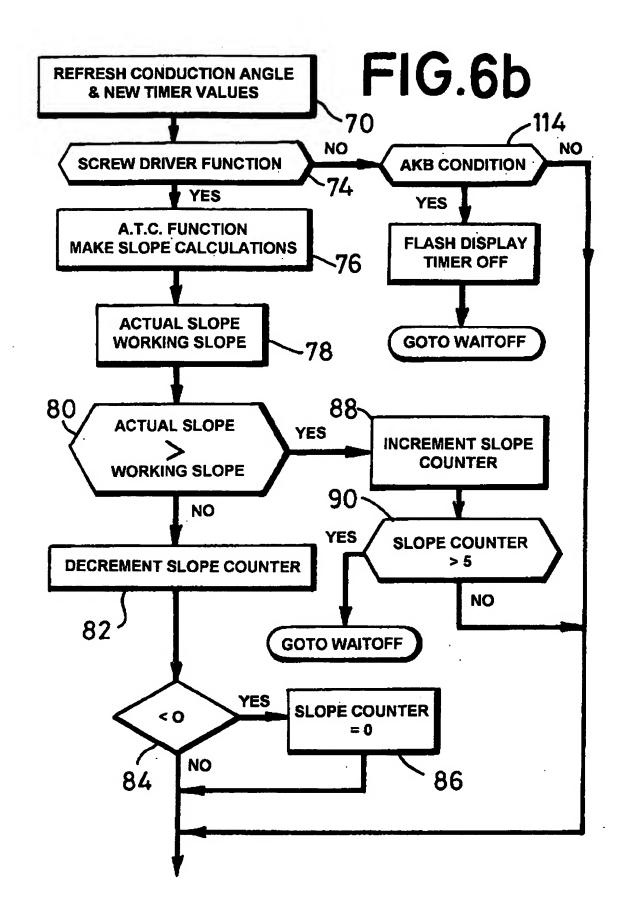

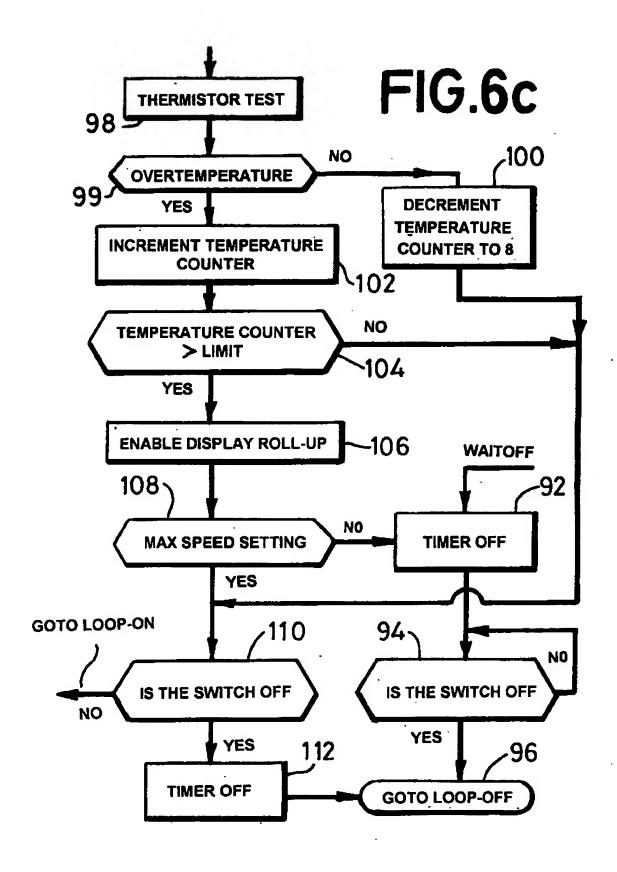
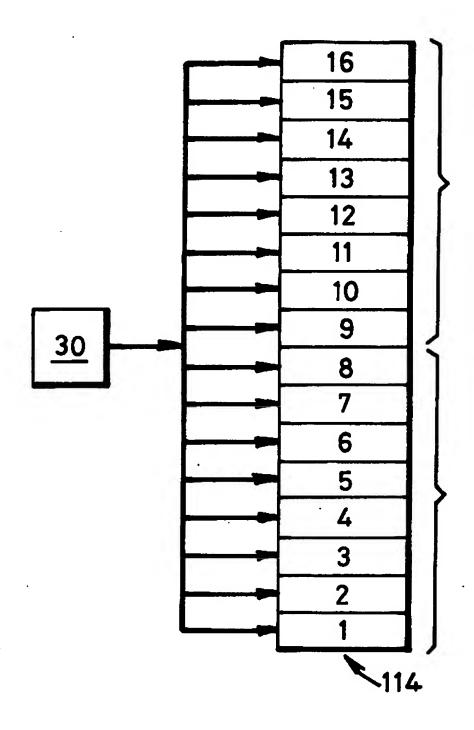


FIG.7



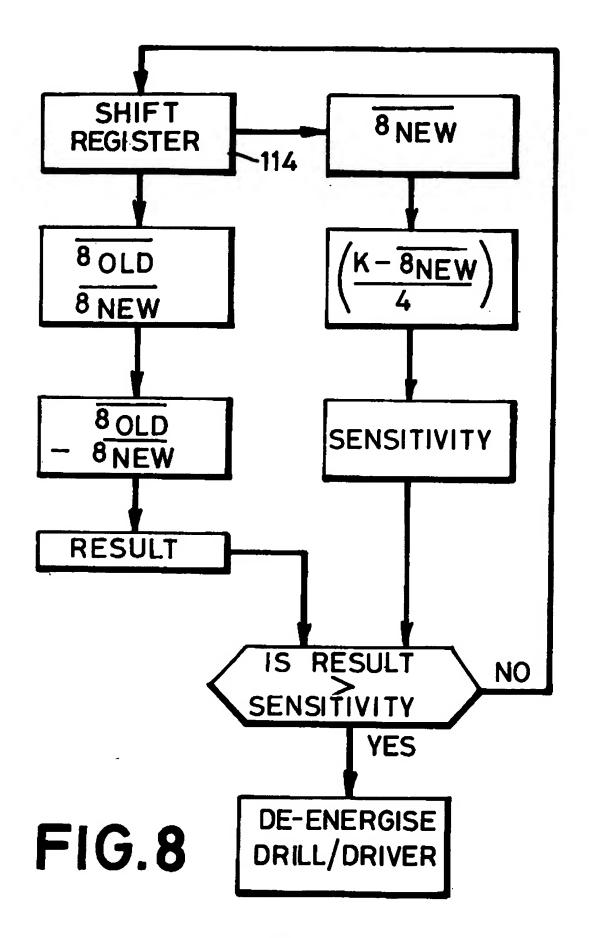


FIG.9

		Y
-150ms	176	374
-140ms	174	372
-130ms	176	374
-120ms	173	371
-110ms	172	370
-100ms	173	371
- 90ms	176	374
- 80ms	172	370
- 70ms	173	373
- 60ms	172	370
- 50ms	174	372
- 40ms	172	370
- 30ms	174	372
- 20ms	176	374
- 10ms	175	373
ACTUAL (Φ)	172	370

8 OLD

8 NEW

TIME POSITION HEXADECIMAL

DECIMAL

FIG.10

-150ms	176	374
-140ms	174	372
-130ms	176	374
-120ms	173	371
-110ms	172	370
-100ms	173	371
- 90ms	176	374
- 80ms	172	370
- 70ms	173	373
- 60ms	172	370
- 50ms	174	372
- 40ms	172	370
- 30ms	174	372
- 20ms	176	374
- 10ms	175	373
ACTUAL (Φ)	172	370

8 OLD

8 NEW

TIME Position HEXADECIMAL

DECIMAL

FIG.11

-150ms	162	354
-140ms	160	352
-130ms	17F	351
-120ms	15D	349
-110ms	15B	347
-100ms	15A	346
- 90ms	159	345
- 80ms	158	344
- 70ms	157	343
- 60ms	156	342
- 50ms	154	340
- 40ms	153	339
- 30ms	151	337
- 20ms	150	336
- 10ms	14E	334
ACTUAL (Φ)	14D	333

8 OLD

8 NEW

TIME POSITION HEXADECIMAL

DECIMAL



1) Publication number: 0 659 525 A3

12

EUROPEAN PATENT APPLICATION

(21) Application number: 94307098.7

(f) Int. CI.⁶: **B25B 23/147**, B23P 19/06

2 Date of filing: 28.09.94

30 Priority: 30.09.93 GB 9320181

43 Date of publication of application: 28.06.95 Bulletin 95/26

(84) Designated Contracting States: CH DE ES FR GB IT LI NL SE


Bate of deferred publication of search report: 06.09.95 Bulletin 95/36

71 Applicant: Black & Decker Inc. Drummond Plaza Office Park 1423 Kirkwood Highway Newark Delaware 19711 (US) (2) Inventor: Shaw, David Martin Woodrising, Lartington Barnard Castle, County Durham (GB)

Representative: Stagg, Diana Christine et al Emhart Patents Department Emhart International Ltd. 177 Walsall Road Birmingham B42 1BP (GB)

(54) Improvements in or relating to power tools.

A drill/driver (eg. an electric drill) with a screwdriver attachment, and a method of controlling the drill/driver, are described. A control circuit (30) controls the speed of rotation of the motor (38, 39) through a time delay circuit (42) and a triac (41). The control circuit (30) uses the time delay information and information inputted from a rotational speed sensor (43) to monitor the current in the motor or a parameter related at least in part to current in the motor. When a change corresponding to an increase in the rate of change of current in the motor is detected, the control circuit (30) stops the motor to provide an automatic torque control feature for a screwdriving operation.

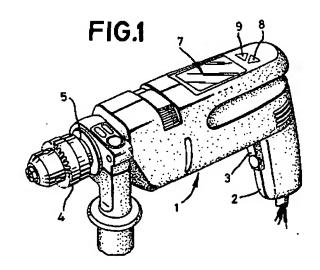



EUROPEAN SEARCH REPORT

Application Number EP 94 30 7098

	· · · · · · · · · · · · · · · · · · ·	DERED TO BE RELEVA	NI	
Category	Citation of decument with in of relevant pas	dication, where appropriate,	Relevant to chain	CLASSIFICATION OF THE APPLICATION (Int.CL6)
X Y	US-A-4 013 895 (T.A) * column 3, line 49 * column 7, line 25 figures 4,13A,13B *	KIYOSHI ET AL.) - column 4, line 13 * - column 8, line 23;	1,10	B25B23/147 B23P19/06
Y	US-A-3 845 373 (K.T * abstract; claim 1	OTSU ET AL.)	8	
Y	DE-A-25 05 393 (ROB * page 2, line 12 -		9	
A	EP-A-0 087 373 (VALI * abstract; figures		1,10	
A	GB-A-2 170 329 (ROB * abstract *	ERT BOSCH GNBH)	1,10	
A	EP-A-0 187 353 (A.K	IPFELSBERGER)		1
X	FR-A-2 087 583 (R.T RADIOTECHNIQUE-COMPI * page 1, line 8 - 1 * page 7, line 1 - 1	ELEC) page 4, line 15 *	11,12	TECHNICAL FIELDS SEARCHED (m.Cl.6) B25B
A	EP-A-0 187 353 (A.K * page 4, line 30 -		11	B23P
A	US-A-4 273 198 (T.D. * column 4, line 29	ONIWA) - column 5, line 21 *	. 11	
		•		
	The present search report has b	een drawn up for all claims		
	Place of search	Data of complation of the search		Execution
	THE HAGUE	8 June 1995		jerus, H
Y: pz.	CATEGORY OF CITED DOCUMEN rticularly relevant if taken alone rticularly relevant if combined with and cannel of the same category thrological background	E : earlier patent after the film ther D : document eft	ciple underlying the focument, but put g date ed in the applications for other reasons	disbed on, or O



European Patent

Office

The present European patent application comprised at the time of filing more than ten claims. All claims fees have been paid within the prescribed time limit. The present European search report has been drawn up for all claims. Only part of the claims fees have been paid within the prescribed time limit. The present European search report has been drawn up for the first ten claims and for those claims for which claims fees have been paid, namely claims: No claims fees have been paid within the prescribed time limit. The present European search report has been drawn up for the first ton claims. LACK OF UNITY OF INVENTION The Search Division considers that the present European patent application does not comply with the requirement of unity of invention and relates to several inventions or groups of inventions, namely: See Sheet -B-	CLA	IMS INCURRING FEES
All claims fees have been paid within the prescribed time limit. The present European search report has been drawn up for all claims. Only part of the claims fees have been paid within the prescribed time limit. The present European search report has been drawn up for the first ten claims and for those claims for which claims fees have been paid, namely claims: No claims fees have been paid within the prescribed time limit. The present European search report has been drawn up for the first ten claims. LACK OF UNITY OF INVENTION The Search Division considers that the present European patent application does not comply with the requirement of unity of invention and relates to several inventions or groups of inventions,		
All claims fees have been paid within the prescribed time limit. The present European search report has been drawn up for all claims. Only part of the claims fees have been paid within the prescribed time limit. The present European search report has been drawn up for the first ten claims and for those claims for which claims fees have been paid, namely claims: No claims fees have been paid within the prescribed time limit. The present European search report has been drawn up for the first ten claims. LACK OF UNITY OF INVENTION The Search Division considers that the present European patent application does not comply with the requirement of unity of invention and relates to several inventions or groups of inventions,	The present	European catent application comprised at the time of filing more than ton dailing
Conty part of the claims less have been paid within the prescribed time limit. The present European search report has been drawn up for the first ten claims and for those claims for which claims less have been paid, namely claims: No claims less have been paid within the prescribed time limit. The present European search report has been drawn up for the first ten claims. LACK OF UNITY OF INVENTION The Search Division considers that the present European patent application does not comply with the requirement of unity of invention and relates to several Inventions or groups of inventions.		
report has been drawn up for the first ten claims and for those claims for which claims fees have been paid, namely claims: No claims fees have been paid within the prescribed time limit. The present European search report has been drawn up for the first ten claims. LACK OF UNITY OF INVENTION The Search Division considers that the present European patent application does not comply with the requirement of unity of invention and relates to several inventions or groups of inventions, namely:		drawn up for all claims.
No claims fees have been paid within the prescribed time limit. The present European search report has been drawn up for the first ten claims. LACK OF UNITY OF INVENTION The Search Division considers that the present European patent application does not comply with the requirement of unity of invention and relates to several inventions or groups of inventions, namely:		Only part of the claims tees have been paid within the prescribed time timit. The present European search report has been drawn up for the first ten claims and for those claims for which claims fees have been paid.
LACK OF UNITY OF INVENTION The Search Division considers that the present European patent application does not comply with the requirement of unity of invention and relates to several Inventions or groups of inventions, namely:		
The Search Division considers that the present European patent application does not comply with the requirement of unity of invention and relates to several inventions or groups of inventions, namely:		No claims fees have been paid within the prescribed time limit. The present European search report has been drawn up for the first ten claims.
The Search Division considers that the present European patent application does not comply with the requirement of unity of invention and relates to several inventions or groups of inventions, namely:		
The Search Division considers that the present European patent application does not comply with the requirement of unity of invention and relates to several inventions or groups of inventions, namely:	LAC	K OF UNITY OF INVENTION
namely:	The Search D	ivision considers that the present European patent application does not comply with the requirement of unity of
see sheet -B-		relaties to several Inventions or groups of inventions,
see sheet -B-		
see sheet -B-		•
	see	sheet -B-
All further search fees have been paid within the fixed time timit. The present European search report has been drawn up for all claims.	X A	Il further search fees have been paid within the fixed time limit. The present European search report has sen drawn up for all claims.
Only part of the further search fees have been paid within the fixed time limit. The present European search report has been drawn up for those parts of the European patent application which relate to the inventions in respects of which search fees have been paid.	re	port has been drawn up for those parts of the European patent application which relate to the inventions in
namely claims:	n	amely claims:
None of the further search fees has been paid within the fixed time limit. The present European search report tras been drawn up for those parts of the European parent application which relate to the invention first mentioned in the claims.	lr	as been drawn up for those parts of the European patent application which relate to the invention first
namely claims:	n n	



European Patent Office

EP 94 30 7098 -B-

LACK OF UNITY OF INVENTION

The Search Division considers that the present European patent application does not comply with the requirement of unity of invention and relates to several inventions or groups of inventions.

A priori in the application EP 94307098 two distinct technical subject matters, which are independent from each other, are claimed.

Claims 1-10: A drill/driver and a method for controlling the same, including means detecting a change (increase) in the rate of change of current in the motor and operative to stop said motor.

Claims 11,12: A method of controlling a drill/driver, the motor thereof being driven only during predetermined conduction periods and said drill/driver being stopped when a value which is a function of the conductive period exceeds a predetermined amount before the end of a given time period.

According to EPC rules only claims 1-10 have been searched.

Description

100011 This invention relates to power screwdrivers and power drills with a screwdriving facility, and which are referred to as "drill/drivers" herein, respectively to a 5 method of controlling such a drill/driver.

[0002] The efficient and economic use of power tools depends upon the correct selection of the conditions under which the tool is to be operated. For example, In a power drill, the speed of rotation of the drill bit 10 depends upon the drill size and the material of the workpiece upon which the drill is to be used. In the case of screwdriving, the rotational speed of the screwdriver is determined in accordance with the screw size. It is also important to be able to stop the tool when the screw has been screwed home fully to avoid overloading the tool driving motor or damage the workpiece.

It has been proposed to employ electronic means to determine, in accordance with information fed to the means by a user, the rotational speed of the motor driving the tool holder of the power tool, such means also maintaining the set speed at a constant value and monitoring the conditions under which the power tool is operating. In particular, the means may monitor the torque exerted by the tool and operate to de-energise the power tool motor in the event that the torque exceeds a safe value, but the prior proposals have not been totally effective.

[0004] Accordingly, it is an object of the present invention to provide a power tool with a more effective torque sensing and control arrangement.

[0005] The present invention is based upon the results of observations of the current which passes through the motor of the power tool during operation, and specifically of the current passing through the motor of a drill/driver as herein defined as it operates to screw a screw into a workpiece. In this respect reference is made to Figure 4 of the accompanying drawings, which is a graph showing changes in motor current (vertical axis) against time (longitudinal axis) that take place during a screw driving operation. The contour of the graph is substantially the same for all permitted screw sizes but the actual current values will depend on the screw size. During period T1, there is a gradual increase in motor current as the screw penetrates the surface of and starts to enter a workpiece, there being a gradual increase in the resistance to rotation offered to the screw. There then follows a time period T2 during which the current flow is substantially constant as the screw thread enters and is driven further into the workpiece. At the end of time period T2, the screw is almost fully home and the screw head engages the surface of the workpiece. As the pressure between the screw head and the surface increases, there is a rapid increase in motor current over the time period T3 at the end of which the screw is fully home and it is then essential to de-energise the tool motor.

[0006] The present invention monitors the current in the motor of the tool, and takes advantage of the rapid increase in current when the head of the screw comes into contact with the workpiece.

[0007] According to the present invention, therefore, a drill/driver comprises a rotatable shaft adapted to mount a screwdriver bit,

a motor for rotatably driving the shaft,

means for monitoring the current in the motor or for monitoring a parameter related at least in part to current in the motor, and

means responsive to a detected change corresponding to an increase in the rate of change of current in the motor, and operative to stop the motor.

[8000]For example, the drill/driver may comprise a speed controller for controlling the speed of rotation of the motor. The means for monitoring the current or other parameter may then monitor the power consumption of the motor.

[0009] In one embodiment, the motor may be an A.C. motor; the speed controller may include voltage controlled rectifier means (also known as gated rectifier means), such as a triac bidirectional rectifier, for controlling the "power-on" portion or portions of each A.C. cycle in order to achieve a desired speed. The means for monitoring the current or other parameter may then comprise means for monitoring the duration of each "power-on" portion. This can be done by monitoring the conduction time of the voltage controlled rectifier means, or by monitoring the relative phase (time delay) at which the voltage controlled rectifier means is triggered. The duration of the "power-on" portion will be related to the load under which the motor is operating, and hence to the current consumption of the motor.

[0010] In some circumstances it may be desirable to continue the screwing operation after the rate of current change has increased, and in one embodiment therefore a time delay is built into the control mechanism to delay, e.g. for a second or so, the motor cut-off. In another embodiment the drill/driver may be provided with a manual override, so that the user may select either automatic cut-off control or manual control.

[0011] The means for monitoring the current or other parameter, and the means for stopping the motor may be implemented in dedicated hardware circuits, and/or by processor means (e.g. a microprocessor or a microcontroller) programmed and configured by software.

[0012] The present invention further provides a method as defined in claim 10

By way of example only, an embodiment of a hand-held power drill/driver according to the present invention will now be described in greater detail with reference to the accompanying drawings of which:

Figure 1 is a perspective view of part of the drill/driver,

25

Figure 2 is a plan view of a display panel and keyboard of the drill/driver.

Figure 3 is a block schematic of the control means of the drill/driver,

Figures 4 and 5a/b are explanatory diagrams and, Figures 6a/b/c are a flow diagram illustrating control of the drill/driver.

[0014] The drill/driver shown in Figure 1 is of generally conventional outward appearance having a body 1 and a handle 2 with a trigger 3 that controls an ON/OFF switch housed in the handle 2. The trigger 3 also incorporates a reversing switch (not shown), although if desired the selection of reverse may be prevented other than during a screwdriving operation. A chuck 4 is detachably mounted on the end of a drive shaft 5 that extends from the body 1 as shown.

[0015] Located on the upper surface of the body 1 in a position easily accessible to, and easily visible to, a user is a keyboard 6 and a display, for example a liquid crystal display (LCD) screen which, together, make up a display panel 7. The display panel 7 is part of a unit that is accommodated within the body 1 and that is held between the clam shell halves that make up the body 1 and handle 2.

[0016]The keyboard 6 has two keys covered by a membrane that covers the actual keys and has upstanding portions 8, 9 in the form of arrow heads that identify the individual keys. To enable a user readily to identify which key to use, the arrow heads 8, 9 point upwardly and downwardly respectively and bear the legends "+" and "-". Beneath the upstanding portions are located the movable elements of the key switches. Such elements may comprise blocks of conductive rubber that are attached to or integral with the membrane and which co-operate with fixed contacts on a surface below the membrane to form the key switches. Downward pressure on an upstanding portion of the membrane 5 brings the block of conductive rubber into electrical contact with the respective fixed contact or conductor pattern on the printed circuit board. As soon as the pressure is removed, the block moves away from the fixed contact.

[0017] The LCD 10 forms part of the display panel 7 which has, adjacent the display 10, columns 12, 13, 14, 15 each with a series of numbers that are drill sizes expressed in millimetres. The numbers are arranged in horizontal rows as shown. At the head of each column are symbols 16, 17, 18, 19 that indicate, respectively, metal workpieces, brick workpieces, wooden workpieces and aluminium workpieces. Below the columns are two horizontal sections 20 and 21 that contain symbolic representations of screws of different sizes and the letters "ATC" (Automatic Torque Control). At the upper right hand edge of the display 10 is symbol 22 representing a polishing or wirebrushing brush. On the right hand side of the display 10 towards the lower end thereof is a set of symbols 23, 24, 25, 26 that represent

respectively a hole cutter, metal workpieces, aluminium workpieces, and wooden workpieces. Engraved on the surface of the display panel in the vicinity of the symbols 23...26 is a two-part arrow head 27 whose point terminates 'just below a horizontal line 28.

[0018] At the lower end of the display panel, as viewed in Figure 2, is the marking Ømm. (diameter).

[0019] The LCD 10 consists of a series of twelve bar segments arranged one above the other. The segments become visible when the switches are operated by a user, depression of the "+" switch causing the number of visible segments to increase from the bottom of the display, whilst depression of the "-" switch has the reverse effect. Depressing both switches together causes the motor to run at maximum speed. By way of example, three visible segments are shown in Figure 2 at 29. As can be seen from Figure 2 the segments are so positioned in the display that, when visible, they are aligned with the different horizontal rows of numbers of the columns 12...15. The display panel 7 enables a user to select the optimum speed (with automatic torque control for screwdriving) for small or large screws (as denoted by the sections 20, 21) or for drilling in metal, brick, wood or aluminium (as denoted by legends 12, 13, 14, 15), or for polishing/wirebrushing (as denoted by legend 22), or hole cutting (as denoted by legend 23 in association with the range legends 24-28).

[0020] Beneath the lower end as viewed in Figure 2, of the LCD display is the marking 200 RPM (the minimum motor speed) on the same horizontal row as the marking Ømm. Above the upper end of the display is the marking 2600 RPM (the maximum motor speed).

[0021] Figure 3 is a block schematic diagram of the tool motor control circuit and comprises a microprocessor 30, for example type 50927 made by the Mitsubishi Company of Japan. The keys of the keyboard beneath the arrow heads 8, 9 shown in Fig. 2 are indicated at 31 and 32 respectively and they input directly to microprocessor 30. Block 33 represents a reset circuit whose function is described below. Block 34 is the LCD 10 whose segments are energised directly from microprocessor 30 as shown. The control circuit is energised from a mains supply at terminals 35, 36 via a power supply unit shown as block 37 and which drops the mains voltage to levels required by the control circuit and at the same time provides the conventional voltage stabilisation. Connected across the terminals 35, 36 is the tool driving motor armature 38 and its series connected field windings 39. The trigger-operated motor control switch is shown at 40. The supply of power to the motor is regulated by a triac 41 that is series connected with the motor and whose firing angle is controlled by the microprocessor 30 via a control circuit shown in Figure 3 as block 42. In this exemplary embodiment, the control circuit 42 comprises a programmable timer which is supplied with a 4-bit time delay input from the microprocessor 30. The time delay corresponds to the phase angle delay at which the triac 41 is to be triggered into

20

25

conduction. Regulation of the rotational speed of the motor is effected by the microprocessor in conjunction with a motor shaft speed measuring circuit represented by block 43. Circuit 43 receives an input from a speed sensing device (not shown) associated with the motor shaft and which may be an optical sensor comprising a slotted disc mounted on the shaft and a light source arranged to direct light through the slotted disc onto a light responsive device. Alternatively, the sensor may be a form of magnetic sensor, for example a Hall effect type sensor, or a coil.

[0022] The control circuit also provides soft start on all operations, anti-kick back protection in all modes, rotation in the reverse direction being permitted only in the screwdriving mode and following operation of the anti-kick back protection.

[0023] Also included in the control circuit is thermal protection of the motor by means of a thermistor or thermostat shown as block 44 that provides a signal indicating motor temperature.

[0024] When the drill/driver is operating in the drilling mode, the control circuit permits the user to select the optimum speed for the drill size and work piece material and maintains that speed despite permitted variations in the load on the motor.

[0025] When the drill/driver, is operating in the screwdriving mode, the control circuit allows selection of small or large screws and automatic torque control.

[0026] In the hole cutting mode, optimum speed selection and control thereof is provided.

[0027] In both polishing and wirebrushing modes the control circuit maintains the motor speed at a constant value despite permitted variations in the load on the motor.

[0028] Reference 45 represents information contacts on the reversing switch.

[0029] As has been explained above, when a screw driving operation is being carried out, it is important to be able to stop the tool motor when the screw has been driven fully home. The drill/driver incorporates torque control to achieve that facility.

Figures 5(a) and 5(b) are waveforms showing the triac conduction patterns when (a) the driver is driving the shank of the screw into the workpiece and (b) the head of the screw comes into contact with the workpiece. In these waveforms, the lines F1...F6 represent a set of firing angles, the firing angles being a measure of the time the triac is on (i.e. the triac conduction time) in order to turn the chuck of the driver at a certain predetermined speed, e.g. 200 rpm. As load is applied to the chuck the conduction time is increased, in order to maintain the required speed. Thus, while the shank is being driven into the workpiece, Figure 5(a), the conduction time (or firing angle) represented by the hatched portion is small. When the screw head reaches the workpiece, however, a substantial increase in conduction time would be required to maintain the speed, as shown by the hatched portion in Figure 5(b). The microprocessor 30 is programmed to recognise the sudden change from the Figure 5(a) situation to that of Figure 5(b) and stop the motor when this occurs.

[0031] Thus, as mentioned, the lines F1....F6 on Figures 5(a) and (b) represent a set of firing angles of the triac, and by monitoring the rate of increase in the firing angle it is possible to detect accurately the instant at which it is desirable to de-energise the tool motor at the end of a screwdriving operation. Thus, each of the firing angles F1...F6 is defined by a value, in this example a 4-bit code, for example angle F1 is defined by the code 0000, F2 by the code 0001, F3 by the code 0011 and so on. The definition of the firing angle is effected by the programming of the microprocessor.

[0032] The microprocessor is also programmed to monitor the rate of change of firing angle and, when a change from say the angle defined by the code 0110 to that defined by the code 1000 occurs within a predetermined time period then the tool motor is de-energised. This illustrates how, in the current example the motor is stopped when there is a detected change which corresponds to an increase in the rate of change of current in the motor. That is, the increase in firing angle within a predetermined time is detected and this firing angle is one such parameter which is related at least in part to the current in the motor. The firing angle codes between which the comparison is made are selected to indicate those at the beginning and the end of the time period T3 shown in Figure 4.

[0033] To bring the drill/driver into use, it is first necessary to connect it to a source of mains power. That initiates a resetting of the control circuit by a signal from the reset circuit 33. Resetting involves the clearing of all memories in the control circuit including that of the LCD 10 and the setting up of all input and output ports and interrupts.

[0034] Figures 6a-c illustrate in flow diagram form a control program for the microprocessor 30. Initially, upon reset as described above, the program is started at step 50 which sets various default values for the drill, for example, the default drill speed for the display panel 7.

[0035] After the initial step 50 the program proceeds to step 52 which tests whether the switch 40 coupled to the trigger 3 is being operated. If the switch is not being operated the program loops through step 54 which implements any input from the display panel 7, the program returning to the test step 52. The program repeats this loop until the user presses the trigger 3 thereby operating the switch 40.

[0036] Once the switch 40 is operated, the program proceeds to further initialisation steps 56 and 58 which set up control variables to control the operation characteristics of the drill/driver. One feature of the drill/driver is soft-start of the drill motor which gradually accelerates the motor rotation from I the desired speed is attained. To achieve a slow turn-on, program step 58 loads the control circuit 42 with a maximum timer value

55

(which corresponds to a maximum delay before the triae 41 is fired, and hence a minimum conduction time).

Speed control is implemented by program steps 60-70 and the soft-start feature is implemented by a sub-loop within the speed control steps as indicated by the loop return 72. Step 60 tests whether the AC power supply is crossing through zero and, if not, the step is merely repeated until a zero-cross is detected. Thereafter, step 62 starts the control circuit (timer) 42 to fire the triac after the predetermined time delay. Step 64 refreshes the soft-start variables if the soft-start feature is still in operation. In particular step 64 reduces the time delay value for the control circuit (timer) 42 in order to increase the conduction time of the triac 41, and hence increase the motor speed. Step 66 tests whether the motor has yet attained or almost attained the desired speed and, if not, the program loops back along the loop return 72 to step 60. Once the motor achieves approximately the desired speed, the program proceeds to step 68 which terminates the soft-start operation. Steps 68 and 70 also perform a speed monitoring and speed stabilisation process. In particular a proportional internal differential (P.I.D) parameter is calculated which indicates the difference between the actual motor speed and the desired speed. Step 70 refreshes the value for the control circuit (timer) 42 and adjusts the value as necessary depending on the P.I.D. parameter. If the actual speed is less than the desired speed, the timer value is decreased thereby to increase the conduction time of the triac 41. If the actual speed is greater than the desired speed, the timer value is increased thereby to decrease the conduction time of the triac 41.

[0038] If the screwdriver option has been selected, the program passes through step 74 to the automatic torque control feature implemented by program steps 76-90. Steps 76 and 78 perform calculations based on the time delay outputted to the control circuit (timer) 42 to determine a working (current-related) slope and an actual (current-related) slope. The working slope represents the slope when the shank of the screw is being driven into the workpiece (represented by the portion T2 of Figure 4). Step 80 tests whether the actual slope exceeds the working slope. The program then modifies a variable called "slope counter" depending on the outcome of the test. The variable indicates the number of recent program occurrences for which the actual slope has exceeded the working slope. Each time that the test step 80 indicates that the actual slope is not greater than the working slope, the program proceeds to step 82 which decrements the slope counter variable. Steps 84 and 86 then test whether the variable has dropped below zero and, if so, the variable is made equal to zero. Each time that the test step 80 indicates that the actual slope is greater than the working slope, the program proceeds to step 88 which increments the slope counter variable. Step 90 then tests whether the variable has exceeded a predetermined value; in this exemplary embodiment the predetermined value is 5. If the predetermined value has been exceeded, this is the condition for the drill to be stopped automatically, and the program branches to a program label "waitoff described below. If the predetermined value has not been exceeded, normal program execution continues.

[0039] This technique with the slope counter variable therefore implements a short delay before turning off the motor- after the actual slope is detected to be greater than the working slope. The motor is not turned off until six consecutive or recent occurrences of such a condition have been detected. The program also avoids stopping the motor in the event of a low number (less than six) of spurious occurrences of an increased slope, since the program steps 82-86 will decrement the value of the slope counter variable on the next occasion that the actual slope is not greater than the working slope.

[0040] The program label "waitoff leads the program into steps 92-96 which automatically stop the motor.

into steps 92-96 which automatically stop the motor. Program step 92 halts the control circuit (timer) 42 thereby to inhibit further conduction of the triac 41, which in turn turns off the power supply to the motor. Program step 94 tests whether the user has yet released the trigger 3 to deactivate switch 40 and, if not, program step 94 is repeated until the user releases the trigger 3. Thereafter, program step 96 returns the program execution to program label "loop-off which leads back to program step 52, to enable the drill to be reused.

[0041] If the program does not branch to "waitoff", execution continues to steps 98-108 which provide an overheating prevention feature. A variable called "temperature counter" is used to record the number of consecutive occasions that an over temperature condition occurs. Program step 100 decrements the temperature counter to zero when the drill is not over temperature, and program execution then jumps to step 110 discussed below. Program step 102 increments the counter when the drill is overtemperature. Program step 104 then tests whether the temperature counter variable has exceeded a predetermined "limit" and, if so, the program branches to the "waitoff" routine if the drill is not in its maximum speed setting. If the drill is in its maximum speed setting the program continues to step 110.

[0042] Program step 110 tests whether the switch 40 is off, i.e. whether the user has released the trigger 3. If not, then the program loops back to a program label "loop-on" which returns to program step 60. In this manner, the program is repeated to provide continuous speed control and, in the screwdriver mode, automatic torque control. If the switch 40 is determined to be off, then program step 112 halts the control circuit (timer) 42 thereby to stop the drill motor in the same manner as program step 92 discussed above. The program then continues to program step, 96 which jumps to the program label "loop-off".

[0043] When the drill is not operating in the screwdriver mode, the automatic torque control feature provided by program steps 76-90 is bypassed. A program

branch is performed by step 74 through step 114. Step 114 provides anti-kickback protection.

[0044] A further safety feature is also provided by a program step 116 interposed between steps 62 and 64 in the speed control portion of the program. Step 116 stests whether the "reverse" switch of the drill has been operated while the drill is in use (i.e. motor turning). If so, program execution branches to step 118 which halts the control circuit (timer) 42 thereby to stop the drill motor. The program then jumps to the program label waitoff "described above."

[0045] The described embodiment is a drill/driver which has an LCD. The invention is of course applicable to any power driver or power drill having a screwdriving facility, against which may be mentioned, for example, power drill/drivers wherein the pre-setting of the tool is by means of a rotating switch controlling a potentiometer rather than by buttons on an LCD display panel.

Claims

- 1. A drill/driver (1) comprising a rotatable shaft (5) arranged to mount a screwdriver bit; a motor (38,39) for rotatably driving the shaft (5); monitor means (30) for monitoring the current in the motor (38,39) or for monitoring a parameter related at least in part to current in the motor (38,39), characterised by further comprising means (30) responsive to a detected change corresponding to an increase in the rate of change of current in the motor (38,39), and operative to stop the motor (38,39).
- 2. A drill/driver according to claim 1, further comprising a speed controller (41) for controlling the speed of rotation of the motor (38,39).
- A drill/driver according to claim 2, wherein the means (30) for monitoring the current or other parameter comprises means for monitoring the power consumption of the motor (38,39).
- 4. A drill/driver according to claim 3, wherein the motor is an A.C. motor, and the speed controller (41) comprises voltage controlled rectifier means for controlling the power-on portion or portions of each A.C. cycle in order to achieve a desired speed.
- A drill/driver according to claim 4, wherein the means (30) for monitoring the current or other parameter comprises means for monitoring the duration of each power-on portion.
- A drill/driver according to claim 5, wherein the means (30) for monitoring the duration comprises means for monitoring the conduction time of the voltage controlled rectifier means.

- 7. A drill/driver according to claim 5, wherein the means (30) for monitoring the duration comprises means for monitoring the relative phase at which the voltage controlled rectifier means is triggered for conduction.
- 8. A drill/driver according to any preceding claim, further comprising control means (42) for implementing a delay before the motor is stopped once a change corresponding to an increase in the rate of change of current has been detected.
- A drill/driver according to any preceding claim, further comprising manual override means for selecting either automatic cut-off control or manual control of the motor.
- 10. A method of controlling a drill/driver, the drill/driver including a rotatable shaft arranged to mount a screwdriving bit and a motor for rotatably driving the shaft, the method comprising monitoring the current in the motor or monitoring a parameter related at least in part to the current in the motor, characterised in that the motor is stopped in response to detection of a change corresponding to an increase in the rate of change of current in the motor.

Patentansprüche

- Bohrschrauber (1) mit einer drehbaren Welle (5), die zur Anbringung eines Schraubeinsatzes ausgestaltet ist; einem Motor (38, 39), um die Welle (5) drehend anzutreiben; einer Überwachungseinrichtung (30) zum Überwachen des Stromes in dem Motor (38, 39) oder zum Überwachen eines Parameters, der zumindest teilweise mit dem Strom in dem Motor (38, 39) in Beziehung steht, außerdem gekennzeichnet durch eine Einrichtung (30), die auf eine erfaßte Veränderung anspricht, die einem Anstieg der Änderungsgeschwindigkeit des Stromes in dem Motor (38, 39) entspricht, und die wirkt, um den Motor (38, 39) anzuhalten.
- Bohrschrauber nach Anspruch 1, außerdem mit einer Geschwindigkeitssteuerung (41), um die Geschwindigkeit der Drehung des Motors (38, 39) zu steuern.
- Bohrschrauber nach Anspruch 2, bei dem die Einrichtung (30) zum Überwachen des Stromes oder anderer Parameter eine Einrichtung zum Überwachen des Stromverbrauchs des Motors (38, 39) enthält.
- 4. Bohrschrauber nach Anspruch 3, bei dem der Motor ein Wechselstrommotor ist und bei dem die Geschwindigkeitssteuerung (41) eine spannungsgesteuerte Gleichrichtereinrichtung enthält, um

45

15

25

30

35

40

50

den Leistung-Ein-Bereich oder Bereiche von jedem Wechselstromzyklus zu steuern, um gewünschte Geschwindigkeit zu erreichen.

- 5. Bohrschrauber nach Anspruch 4, bei dem die Ein- σ richtung (30) zum Überwachen des Stromes oder anderer Parameter eine Einrichtung zum Überwachen der Dauer von jedem Leistung-Ein-Bereich enthält.
- 6. Bohrschrauber nach Anspruch 5, bei dem die Einrichtung (30) zum Überwachen der Dauer einer Einrichtung zum Überwachen der Durchlaßzeit der spannungsgesteuerten Gleichrichtereinrichtung enthält.
- 7. Bohrschrauber nach Anspruch 5, bei dem die Einrichtung (30) zum Überwachen der Dauer einer Einrichtung zum Überwachen der relativen Phase enthält, bei der die spannungsgesteuerte Gleich- 20 richtereinrichtung in den leitenden Zustand geschaltet wird.
- 8. Bohrschrauber nach einem der vorhergehenden Ansprüche, der außerdem eine Steuerungseinrichtung (42) enthält, um eine Verzögerung zu implementieren, bevor der Motor angehalten wird, wenn eine Veränderung erfaßt ist, die einem Anstieg der Anderungsgeschwindigkeit des Stromes entspricht.
- 9. Bohrschrauber nach einem der vorhergehenden Ansprüche, der außerdem eine manuell betätigbare Umgehungseinrichtung hat, um entweder die automatische Abschaltsteuerung oder die manuelle Steuerung des Motors auszuwählen.
- 10. Verfahren zur Steuerung eines Bohrschraubers, bei dem der Bohrschrauber eine drehbare Welle, die zur Anbringung eines Schraubeinsatzes ausgestaltet ist, und einen Motor aufweist, um die Welle drehend anzutreiben, wobei das Vertahren das Überwachen des Stromes in dem Motor oder das Oberwachen eines Parameters umfaßt, der zumindest teilweise mit dem Strom in dem Motor in Beziehung steht, dadurch gekennzeichnet, daß der 45 Motor in Reaktion auf das Erfassen einer Veränderung, die einem Anstieg der Änderungsgeschwindigkeit des Stromes in dem Motor entspricht, angehalten wird.

Revendications

1. Perceuse/visseuse (1) comprenant un arbre rotatif (5) adapté pour porter une lame de tournevis ; un moteur (38, 39) servant à entraîner l'arbre (5) en 65 rotation ; des moyens (30) servant à surveiller le courant qui circule dans le moteur (38, 39) ou à surveiller un paramètre lié au moins en partie au courant qui circule dans le moteur (38, 39), caractérisé en ce qu'il comprend en outre des moyens (30) qui répondent à une modification détectée qui correspond à un accroissement de la vitesse de variation du courant circulant dans le moteur (38, 39) et qui entre en jeu pour arrêter le moteur (38, 39).

- 2. Perceuse/visseuse selon la revendication 1, comprenant en outre une commande de vitesse (41) destinée à commander la vitesse de rotation du moteur (38, 39).
- Perceuse/visseuse selon la revendication 2, dans laquelle les moyens (30) destinés à surveiller le courant ou un autre paramètre comprennent des moyens destinés à surveiller la consommation d'énergie du moteur (38, 39).
- Perceuse/visseuse selon la revendication 3, dans laquelle le moteur est un moteur à courant alternatif et la commande de vitesse (41) comprend des moyens redresseurs commandés par une tension, destinés à commander la portion ou les portions en circuit de chaque cycle du courant alternatif afin d'atteindre la vitesse désirée.
- 5. Perceuse/visseuse selon la revendication 4, dans laquelle les moyens (30) destinés à surveiller le courant ou à un autre paramètre comprennent des moyens destinés à surveiller la durée de chaque portion en circuit.
- 6. Perceuse/visseuse selon la revendication 5, dans laquelle les moyens (30) destinés à surveiller la durée comprennent des moyens destinés à surveiller le temps de conduction des moyens redresseurs commandés par une tension.
- Perceuse/visseuse selon la revendication 5, dans laquelle les moyens (30) destinés à surveiller la durée comprennent des moyens destinés à surveiller la phase relative à laquelle les moyens redresseurs commandés par une tension sont déclenchés pour être mis en conduction.
- Perceuse/visseuse selon une quelconque des revendications précédentes, comprenant en outre des moyens de commande (42) destinés à réaliser un retard avant que le moteur ne soit arrêté une fois qu'une variation correspondant à un accroissement de la vitesse de variation du courant a été détectée.
- 9. Perceuse/visseuse selon une quelconque des revendications précédentes, comprenant en outre des moyens prioritaires manuels permettant de sélectionner, soit la commande automatique de la coupure, soit la commande manuelle du moteur.

10. Procédé pour commander une perceuse/visseuse, la perceuse/visseuse comprenant un arbre rotatif agencé pour porter la lame de visseuse et un moteur destiné à entraîner l'arbre en rotation, le procédé comprenant les phases consistant à sur- 5 veiller le courant circulant dans le moteur ou à surveiller un paramètre lié au moins en partie au courant circulant dans le moteur, caractérisé en ce que le moteur est arrêté en réponse à la détection d'une variation qui correspond à un accroissement 10 de la vitesse de variation du courant circulant dans le moteur.

15

20

25

30


35


40


45


50


55

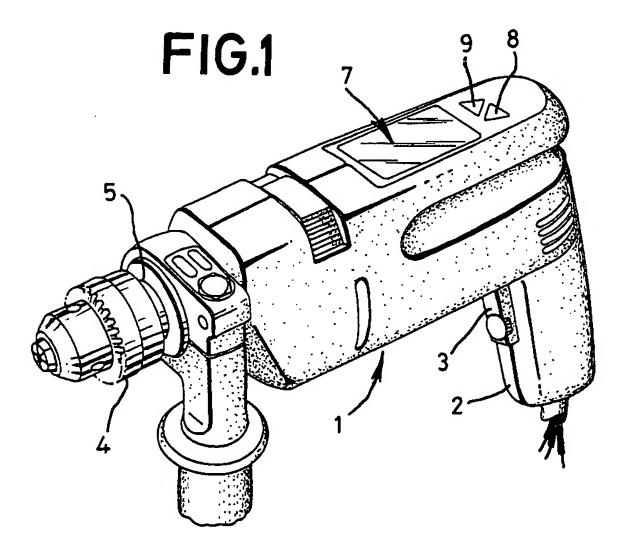


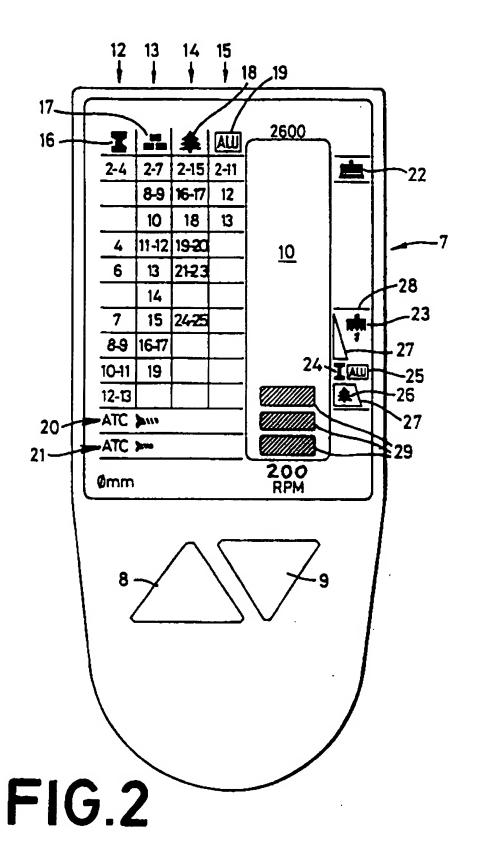


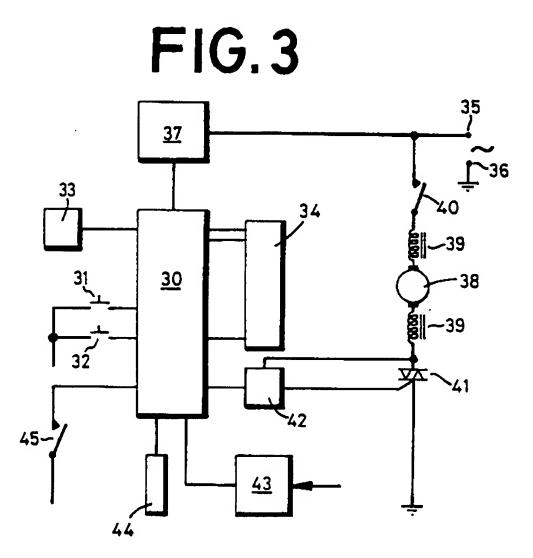

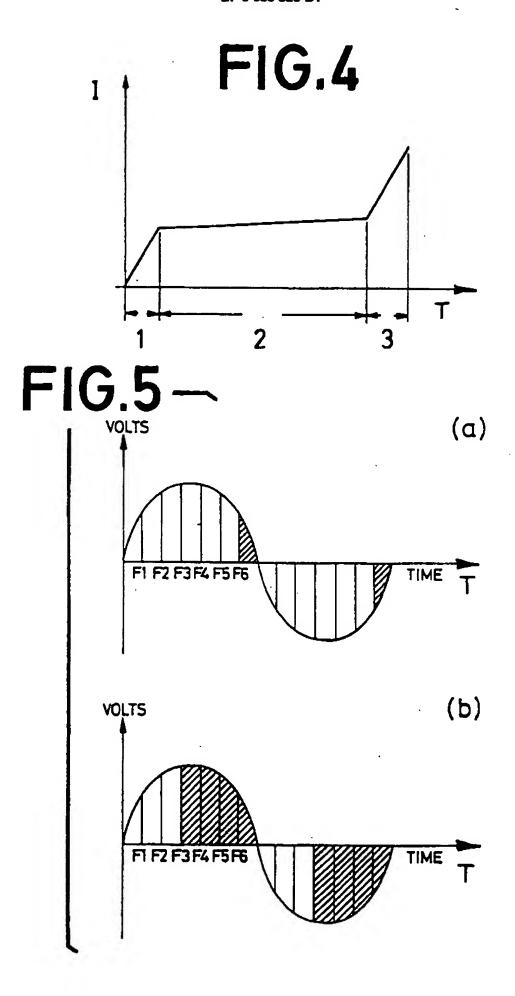

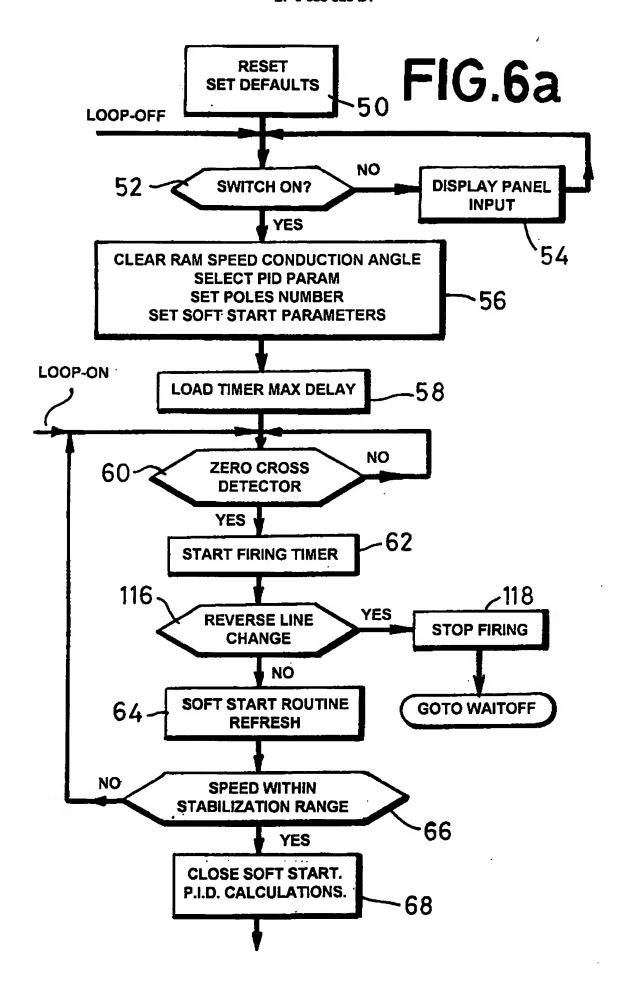

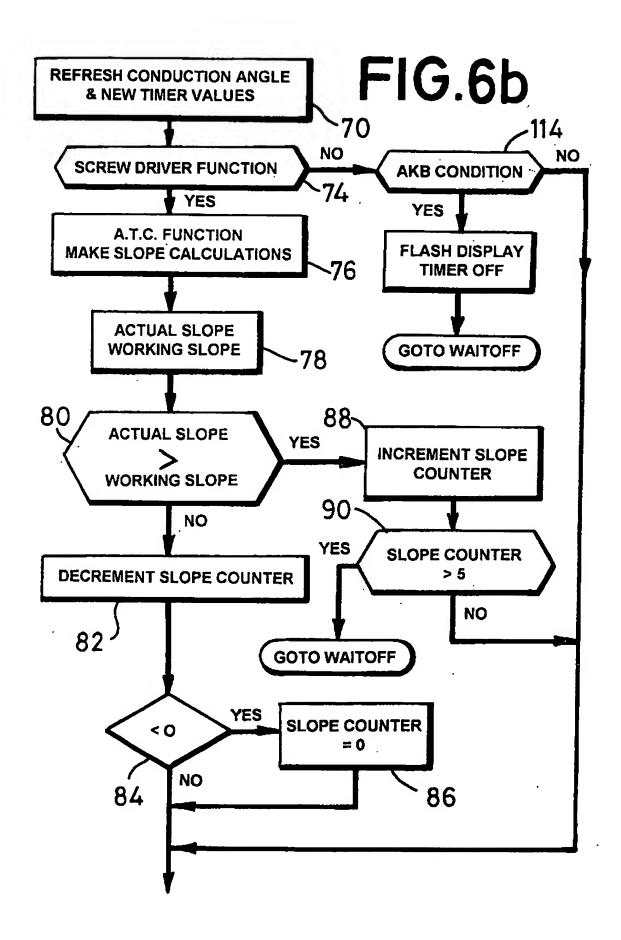

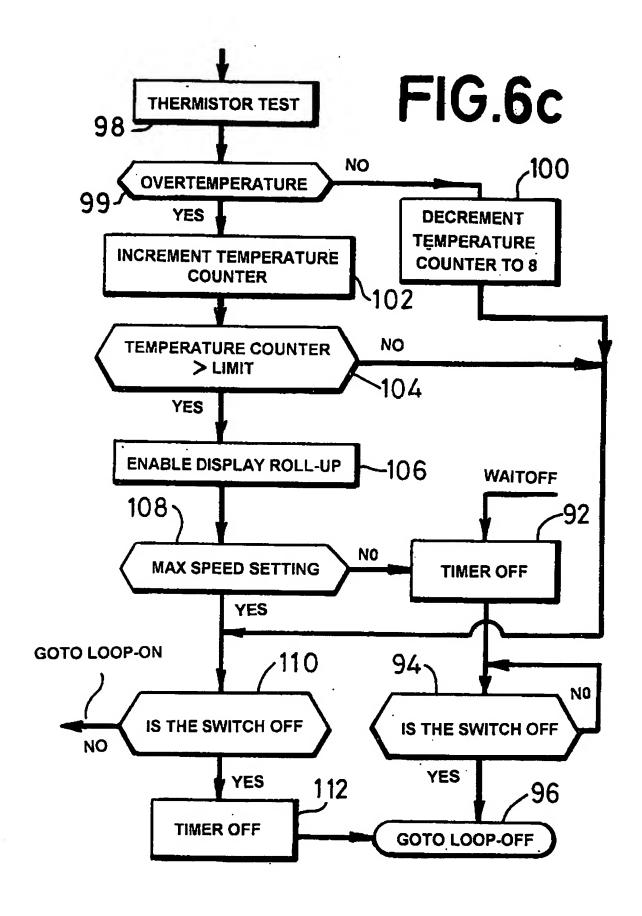

Improvements in or relating to power tools

Patent number:

EP0659525

Publication date:

1995-06-28

Inventor:

SHAW DAVID MARTIN (GB)

Applicant:

BLACK & DECKER INC (US)

Classification:

- international:

B25B23/147; B23P19/06

- european:

B23P19/06C1; B25B23/147

Application number:

EP19940307098 19940928

Priority number(s):

GB19930020181 19930930

Also published as:

US5563482 (A1) JP7178678 (A) EP0659525 (A3)

EP0659525 (B1)

CA2133244 (C)

Cited documents:



US4013895 US3845373

DE2505393


EP0087373 GB2170329

more >>

Report a data error here

Abstract of EP0659525

A drill/driver (eg. an electric drill) with a screwdriver attachment, and a method of controlling the drill/driver, are described. A control circuit (30) controls the speed of rotation of the motor (38, 39) through a time delay circuit (42) and a triac (41). The control circuit (30) uses the time delay information and information inputted from a rotational speed sensor (43) to monitor the current in the motor or a parameter related at least in part to current in the motor. When a change corresponding to an increase in the rate of change of current in the motor is detected, the control circuit (30) stops the motor to provide an automatic torque control feature for a screwdriving operation.

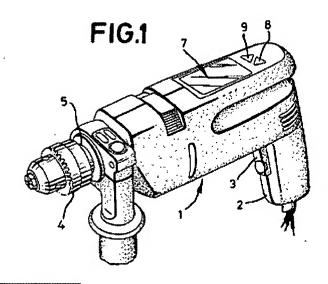

Data supplied from the esp@cenet database - Worldwide

This Page is Inserted by IFW Indexing and Scanning Operations and is not part of the Official Record

BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images include but are not limited to the items checked:

□ BLACK BORDERS
□ IMAGE CUT OFF AT TOP, BOTTOM OR SIDES
□ FADED TEXT OR DRAWING
□ BLURRED OR ILLEGIBLE TEXT OR DRAWING
□ SKEWED/SLANTED IMAGES
□ COLOR OR BLACK AND WHITE PHOTOGRAPHS
□ GRAY SCALE DOCUMENTS
□ LINES OR MARKS ON ORIGINAL DOCUMENT
□ REFERENCE(S) OR EXHIBIT(S) SUBMITTED ARE POOR QUALITY

IMAGES ARE BEST AVAILABLE COPY.

□ OTHER: __

As rescanning these documents will not correct the image problems checked, please do not report these problems to the IFW Image Problem Mailbox.